

RECEIVING AND ESTIMATING REPORT				COMMENTS		ORDER R 91-23633			
INITIAL		CUSTOMER ORDER NO.							
FPS									
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE				
11/14/91	11/20/91	WD 8-77	6577001		700 30-06	ADL			
ACCESSORIES		SCOPE BASE		L/SIGHTS					
FROM:				SHIP TO:					
BIG BEAR SUPPLY 4800 S 10TH ST GREAT FALLS MT 59405				BIG BEAR SUPPLY 4800 S 10TH ST GREAT FALLS MT 59405					
CUST NO: 003285 ILION L									
ACCOUNT NUMBER		ACCOUNT NUMBER N/C		WRITE <input type="checkbox"/>	CLEAN/TEST	PROM. DATE	ESTIMATED		
							VIA UPS		
GUN CONDITION						REPAIR CHARGE			
<input type="checkbox"/> NEW						EXCISE			
<input type="checkbox"/> LIGHTLY WORN						TAX			
<input type="checkbox"/> WORN						INSURANCE			
<input type="checkbox"/> VERY WORN						UPS			
<input type="checkbox"/> UNREPAIRABLE						PARCEL POST			
						TOTAL			
CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT			
CYCLE	A1	B1							
TRIGGER GROUP	<i>"MR WEBSTER SAID THAT WHEN HE WAS MOVING THE SAFE TO FIRE, THE GUN DISCHARGED"</i>				E2	F2			
BOLT ASSY.					B3				
BARREL ASSY.					B4	D1	E3	F3	
REC. ASSY.					B5	D2	E4	F4	
WOOD						C1	D3	E5	F5
METAL			C2						
MAIN FAULT <i>Cannot duplicate complaint, however, trigger assembly has been inspected &amp; adjusted outside factory - 1) trigger pull measured at 1 1/2 pounds 2) over travel excessive - foreign red color sealant on three two (2) adjusting screws. trigger pull adjustment screw has been backed-out to the point there is no resistance spring force on trigger, therefore, the rear engagement can vary each time the gun is cocked. Brushily closing the bolt causes the firing pin to follow down. Seal lift .007"</i>									
PARTS				COMMENTS					
				<i>Offer new trigger assembly at 1/2 normal cost, as a gesture of customer good-will.</i>					
				REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
				GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV. 8/9

PPS 00473