

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 6601
GENERAL CONDITION: GOOD R # : 001996
OUTSIDE WORK: SCOPE MOUNTED DATE: 1-31-72
FROM: BONITZ BROS. INC.
FIRED AMMO TYPE: - HARRISBURG, PA.
& CONDITION: _____ GUN # : 127052
PROOF: R.E.P. ASSEMBLER 83 INSP.: U TEST: 13 CODE: ER= 10/62
HEADING: - GA./CAL.: 6.5MM REM-UMC.
BREECH OPENING: - CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: No APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

RUST AROUND TRIGGER AND BETWEEN BOLT FINGER
FIRING PIN & BOLT ASSEMBLY. TRIGGER FULL 3/4 IN.
(SPEC. 4 TO 6) ENGAGEMENT .010 (SPEC. .020 MIN.)

COMPLAINT: "FIRED TWICE WHEN SAFETY WAS PUT IN OFF POSITION"

INCIDENT: FOLLOW DOWN.

COMMENTS: AS RECEIVED. RUST IN FIRING PIN ASSEMBLY MADE IT
DIFFICULT TO CLOSE AND LOCK BOLT. FIRING PIN
WOULD NOT FALL. IT IS PROBABLE THAT THE RUST
AROUND THE TRIGGER COMBINED WITH UNDER MIN ENGAGE-
MENT & UNDER MIN. TRIGGER PULL, CAUSED THE TRIGGER-
CONNECTOR TO FAIL TO RETRACT WHEN PULLED WITH
THE SAFETY ON. RELEASING THE SAFETY ALLOWED
THE FIRING PIN TO FALL.