

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 EDL
GENERAL CONDITION: NEW R #: 006000
OUTSIDE WORK: SCOPES MOUNTED DATE: 3-13-72
FROM: BRACE, HOW. CO.
FIRE AMMO TYPE: _____ BRIDGEVILLE, PA.
& CONDITION: _____ GUN #: 6243354
PROOF: R.E.P. INSP.: 73 TEST: 87 CODE: 05-2/69
HEADING: _____ GA./CAL.: 308
BREECH OPENING: _____ CHECKED BY: C. PROSTON
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEARS INTACT. ENGAGEMENT .073 (MIL) (0.00073)
CONNECTOR CLEARANCE ON TRIGGER = 1.069 ($\frac{MIL}{1.000}$) TRIGGER
CLEARANCE ON CONNECTOR = 1.090 ($\frac{MIL}{1.000}$) THIS ADDS UP TO
.014 MORE CLEARANCE BETWEEN CONNECTOR AND TRIGGER THAN
SPECIFICATIONS.

COMPLAINT: FIRES WHEN SAFETY IS RELEASED

INCIDENT: FOLLOW DOWN

COMMENTS: THE EXCESSIVE CLEARANCE BETWEEN THE TRIGGER
AND CONNECTOR ALLOWS THE CONNECTOR TO HOOK UP
AND CATCH ON THE SEAR PREVENTING RETRACTION
CAUSING FOLLOW DOWN.