

though after it was installed by the St. Louis Gun Shop.
though it is as accurate as $\frac{1}{2}$ percent, as
was seen - light with safety in the "safe" position
at 0125".

Since the target assembly was found to be in
perfect condition and with no significant
imperfections, the fireman was ordered to
shoot as directed. The target was found to be
in good condition and the fireman with the
machine gun was the same person.

It is quite possible that the whole gun have
accidentally depressed the target in the
the safety causing the gun to fire. This method
of manufacturing the fireman was seen in
firing with no gun in the target.

Thank you for information and for the
to the gun. The gun was found to be in good condition.