



ML:RT 6/28/88 01 ARMS SERVICE FILE

REMINGTON ARMS COMPANY, INC.

SPORTING FIREARMS, AMMUNITION, TARGETS AND TRAPS



WILMINGTON DE 19898

~~XXXXXXXXXXXX~~

01-007972-3

D/A7331235

INVOICE NO. R-98-16624

SHIP DATE

PLEASE MAIL
REMITTANCE
TO BOX CHECKED

WILMINGTON, N. Y. 13357

Quinta Ace Hardware
1400 Industrial Blvd.
Caralana AL 36571
Ref. #917864

98-16624-700

SHIP VIA JTC

CA 4-80

700 24, EBL A601901
/studs

COMPLAINT: Gun fired when opening and closing bolt. Stock warped.
MAIN FAULT: Trigger assem. has been improperly adjusted outside
factory. Trigger pull of .near engagement excessive, not enough
over travel. Insufficient over-travel adjustment causes connector
to sometimes catch on sear-safety arm.

1. 26435 Trigger assem. I.O.C
2. Could not adjust trigger assem.
3. Polished chamber
4. Check headin
5. Test

TOTAL REPAIR CHARGE	20.00
STOCK	
UPS	4.39
TOTAL CHARGES	24.39

CUSTOMER'S SIGNATURE

ML