

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R92-17499INITIAL
FPS

CUSTOMER ORDER NO.

L/FLOOR PLATE, SCREWS

DATE RECEIVED
98/20/92DATE OPENED
99/01/92DATE CODE
00 7-78SERIAL NUMBER
A6648299

NEW SERIAL NUMBER

MODEL AND GRADE

700 270 WIN LH

ACCESSORIES

L/MAG BOX

L/WOOD

L/FOLLOWER

L/MAG SPRING

SCOPE BASE

L/SIGHTS

FROM:

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ 07109

SHIP TO:

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ

07109

CUST. NO: 009025 C.O.D

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	1) Sometimes bolt would not cycle when opened				
TRIGGER GROUP		2) Sometimes bolt would fall when safety released				
BOLT ASSY.		3) Now getting lighter hit on pinners.				F2
BARREL ASSY.				D1	E3	F3
REC. ASSY.		B5		D2	E4	F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT

Cannot duplicate complaints 1 & 2 above - rifle seems to operate properly however, trigger has been improperly adjusted, out of factory - 1) trigger pull above maximum (com. spec. of 15 lb pounds - measured at 22 lb) 2) insufficient over-travel, also trigger assembly contains an excessive amount of oil, dust, dirt, etc.

ARTS

COMMENTS

1) Offer to clean & readjust present trigger assembly to our specs.
or
2) we can install a new trigger group at a normal cost, if that will better our confidence in the rifle

Check out firing pin indent on pin #2 complaint.

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
hse					
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

PPS 00772