

Remington.



REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

March 20, 1989

DCC: Arms Service
R-89-06846
Make repairs at no-charge
Fit new trigger assembly.

Cliff's Rifle Shop
147 South Airport Rd.
Traverse City, MI 49684

Dear Sir:

Our experts have completed their examination on the Model 700 ADL 7mm magnum rifle, serial number A6302262, that you returned to us with the alleged complaint that it fires at random.

The returned firearm, which was produced in May of 1988, has been thoroughly examined and found to have our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to shipment from our factory.

The general condition of the rifle appeared to be very good. In going over the individual parts, we found headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not produce any malfunctions. All tolerances and dimensions were found to be normal. Trigger pull measured to be 5-1/2 pounds, and the sear lift with the safety in the on safe position was well within specifications at .0105.

Removal of the barrel action from the stock assembly revealed that trigger assembly contained dirt and excessive amount of oil (?). The sear safety cam, bolt stop, and bolt stop release were very sticky and movement of these components was very sluggish.

In future use, we recommend that oil be used sparingly and not let accumulate in or on the trigger assembly, as this condition could adversely affect the operation of the trigger assembly.