

*Customer Complaint*

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_

MODEL: 660

GENERAL CONDITION: NEW

R #: 27164

OUTSIDE WORK: SCOPE MOUNTED

DATE: 12-28-71

FIRED AMMO TYPE: -

FROM: J.W. CUMMINGS, SR.

AVERILL PARK, N.Y.

& CONDITION: \_\_\_\_\_

GUN #: 127752

PROOF: R.E.P. INSP.: 97 TEST: 13

CODE: PR = 6/03  
BU = 1/71  
RU = 2/71

HEADING: O.K.

GR./CAL.: 350 REM. MAG.

BREECH OPENING: -

CHECKED BY: C. PROSSER

RECOIL SHOULDERS: O.K.

APPROVED: \_\_\_\_\_

CHAMBER: O.K.

APPROVED: \_\_\_\_\_

TEST: NO

APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: \_\_\_\_\_

NO DAMAGED, BROKEN COMPONENTS.  
SEAR-TRIGGER CONNECTOR ENGAGEMENT .025, TRIGGER  
PULL 5 POUNDS - CREEPS. TOO MUCH - TOO HEAVY  
LUBRICATION IN HOUSING ASSEMBLY. TRIGGER RIDES  
LEFT INSIDE OF HOUSING.

COMPLAINT: CREEPY TRIGGER PULL. RIFLE FIRED WHEN  
BOLT HANDLE WAS RAISED.

INCIDENT: FOLLOW DOWN.

COMMENTS: THE CUSTOMERS MALFUNCTION, FOLLOWS DOWN,  
COULD NOT BE DUPLICATED. THE EXCESSIVE LUBRICATION  
WITH THE TRIGGER RIDING THE INSIDE WALL OF THE  
HOUSING COULD CAUSE THE MALFUNCTION ESPECIALLY  
IN COLD WEATHER.