

Cust Copy

P.I. No GUN EXAMINATION REPORT NUMBER: _____

MODEL: 700 ADL

GENERAL CONDITION: GOOD

R #: 000130

OUTSIDE WORK: SCOPE MOUNTED, BUTT PAD
FITTED.

DATE: 1-11-73

FROM: ESTELL CURRY

FIRED AMMO TYPE: _____

GATESVILLE, TEXAS

& CONDITION: _____

GUN #: 165224

PROOF: R.E.P. ASSEMBLER 6 INSP.: D TEST: B7

CODE: WM = 8/65

HEADING: -

GA./CAL.: 243 WIN.

BREECH OPENING: -

CHECKED BY: C. PROSSER

RECOIL SHOULDERS: O.K.

APPROVED: _____

CHAMBER: O.K.

APPROVED: _____

TEST: NO

APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style)

APPROVED: _____

STEEL CHIPS BETWEEN TRIGGER AND CONNECTOR.
HARDENED LUBRICANT AROUND SEAR. EVIDENCE OF
FIRING PIN HEAD CATCHING ON REAR-LEFT CORNER
OF HOUSING.

COMPLAINT: FIRED AS BOLT WAS UNLOCKED

INCIDENT: FOLLOW DOWN

COMMENTS: THE CHIPS BETWEEN TRIGGER AND CONNECTOR
CAUSE SEAR-CONNECTOR ENGAGEMENT TO VARY,
LEADING TO FOLLOW-DOWN. THE HARDENED
LUBRICANT AND FIRING PIN HEAD-HOUSING INTER-
FERANCE ALSO CONTRIBUTE TO FOLLOW-DOWN
MALFUNCTIONS.