

Remington.

bcc: Arms Service R89-16549
Fit new trigger assm- n/c



REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

July 12, 1989

Delta Hardware Co.
Attn: Richard Alderse
1163 West Edwards
Tunica, MS 38676

Dear Mr. Alderse:

Examination has been completed on the Model 700 BDL 7mm Rem. Mag. caliber rifle, serial number B6276621, which you returned to us because "the customer says it will fire when the safety is let off."

The returned firearm, which was produced in November of 1980, has been thoroughly examined and found to contain our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to being shipped from our factory.

The general condition of the rifle appeared to be good, and it was noted that a scope mount had been added. In going over the individual parts, we found the headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not produce the alleged complaint of the rifle firing when the safety was moved. All tolerances and dimensions were found to be normal. Trigger pull was measured to be 4-1/2 pounds, and the sear-lift with the safety in the "on-safe" position was within specifications at .008".

Removal of the barreled-action from the stock revealed that the underside of the receiver and trigger assembly were wet with excessive lubrication. The inside of the trigger assembly was also contaminated with excessive oil. In future use, we recommend that oil