

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 BDL
GENERAL CONDITION: NEW R # : 026826
OUTSIDE WORK: SCOPE MOUNTED DATE: 12-18-72
FROM: DICK'S SPT. SHOP
FIRED AMMO TYPE: _____ STAHLSTOWN, PA.
& CONDITION: _____ GUN # : 6223531
PROOF: R.E.P. ASSEMBLER C INSP.: ? TEST: 87 CODE: AS = 3/69
HEADING: O.K. GA./CAL.: 3006
BREACH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

SEAR-TRIGGER CONNECTOR ENGAGEMENT .015 (MIN. 15.020) BURRS ON SEAR AND TRIGGER. TRIGGER 1.074 (MODEL DRAWING = ^{1.076}1.079) CONNECTOR 1.081 (^{1.080}1.083) SAFETY CENTER OF PIVOT TO TOP OF CAM .290 (^{1.292}1.296)

COMPLAINT: "MISFIRES WHEN HE PUSHES THE SAFE OFF"

INCIDENT: FOLLOW DOWN

COMMENTS: FOLLOW DOWN COULD HAVE BEEN DUE TO BURRS BINDING AND PREVENTING RETRACTION OR EXCESSIVE CONNECTOR-TRIGGER CLEARANCE ALLOWING THE CONNECTOR TO WORK UP TO INTERFERE WITH THE SEAR WHICH THE SAFETY DID NOT LIFT ENOUGH TO CLEAR.