

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL

GENERAL CONDITION: GOOD R #: 024437

OUTSIDE WORK: SCOPE MOUNTED, RECOIL PAD DATE: 11-22-72

ADDED FROM: DONALDSON'S GUNSHOP

FIRED AMMO TYPE: - MINNEAPOLIS, MINN.

& CONDITION: _____ GUN #: 309624

PROOF: R.E.P. ASSEMBLER 65 INSP.: 96 TEST: 87 CODE: EP = 10/67

HEADING: O.K. GA./CAL.: 3006

BREECH OPENING: - CHECKED BY: C. PROSSER

RECOIL SHOULDERS: O.K. APPROVED: _____

CHAMBER: O.K. APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

CONNECTOR CLEARANCE ON TRIGGER .003 UNDER MIN.
BURRS ON SIDES OF TRIGGER. HOUSING PROTRUDES
INTO FIRING PIN HEAD SLOT. SEAR-TRIGGER CONNECTOR
ENGAGEMENT .025

COMPLAINT: FIRED UPON LOCKING THE BOLT.

INCIDENT: FOLLOW DOWN

COMMENTS: THE CUSTOMER'S MALFUNCTION CAN NOT BE
DUPLICATED AND THERE IS NO EVIDENCE OF SUCH
MALFUNCTION, HOWEVER, THE TRIGGER BURRS,
EXCESSIVE TRIGGER-TRIGGER CONNECTOR CLEARANCE,
AND HOUSING PROTRUDING COULD CONTRIBUTE TO
SUCH A MALFUNCTION.