

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL

GENERAL CONDITION: NEW R # : 002696

OUTSIDE WORK: NO DATE: 2-1-72

FIRED AMMO TYPE: — FROM: DUPP'S SHOOTERS

& CONDITION: _____ SUPPLY. ADDFLETON, WIS.

PROOF: R.E.F. - H INSP.: 71 TEST: 49 GUN # : 6310595

HEADING: O.K. CODE: LT = 2/70

BREECH OPENING: — GAT./CAL.: 3006 S&W

RECOIL SHOULDERS: O.K. CHECKED BY: C. PROSSER

CHAMBER: O.K. APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER PULL 4LBS., ENGAGEMENT .012 (MIN. IS .020)

APPEARS TO BE GREASE ON SIDES OF TRIGGER ALSO BURR
ON TOP SIDE EDGES (RUB MARKS LOWER REAR SIDES)

COMPLAINT: RIFLE DISCHARGED BY ITSELF TWO OUT OF SIX TIMES
FIRE.

INCIDENT: FOLLOW DOWN.

COMMENTS: MARKS ON THE TRIGGER INDICATE FRICTION. THE
COMBINATION OF FRICTION, HEAVY LUBRICANT AND UNDER
MIN. ENGAGEMENT PROBABLY PREVENTED TRIGGER-
CONNECTOR RETRACTION CAUSING FOLLOW DOWN.