

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700 ADL
 GENERAL CONDITION: GOOD R #: 027716
 OUTSIDE WORK: SCOPE MOUNTED, ALL SEALS DATE: 1-4-73
BROKEN ON TRIGGER ASSEMBLY FROM: DUNHAM'S
 FIRED AMMO TYPE: - MEDFORD, OREGON
 & CONDITION: _____ GUN #: 369419
 PROOF: R.E.P. ASSEMBLER 13 INSP.: 13 TEST: ? CODE: DR = 9/68
 HEADING: O.K. GRA./CAL.: 3006
 BREACH OPENING: _____ CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

HARDENED LUBRICANT CAUSING TRIGGER BIND. TRIGGER
STOP SCREW OUT OF POSITION BINDING IN CONNECTOR.

COMPLAINT: FIRES ON RELEASING SAFETY

INCIDENT: FOLLOW DOWN

COMMENTS: THE OUT OF POSITION STOP SCREW HOLDS THE
TRIGGER CONNECTOR IN FIRED POSITION CAUSING
FOLLOW DOWN.