

M/700 Customer Complaint.

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: 700

GENERAL CONDITION: NEW R #: 012758

OUTSIDE WORK: FRONT ADJUSTING SCREWS DATE: 6-12-72

UNSEALED. FROM: J.V. ELIOT JR.

FIRED AMMO TYPE: - SAN MEOTO, CALIF.

& CONDITION: \_\_\_\_\_ GUN #: 6446926

PROOF: R.E.P.-L INSP.: ASSEM. 30 TEST: 51 TEST: 84 CODE: DU= 9/71

HEADING: O.K. GR./CAL.: 17 REM.

BREECH OPENING: - CHECKED BY: G. PROSSER

RECOIL SHOULDERS: EXCESSIVE RADIUS APPROVED: \_\_\_\_\_

CHAMBER: O.K. APPROVED: \_\_\_\_\_

TEST: NO APPROVED: \_\_\_\_\_

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

CORNER OF SEAR CHIPPED OFF. FIRING PIN HOLE NOT  
ROUNDED. FIRING PIN HOLE, REAR, NOT CLEANED - FIRING  
PIN ASSEMBLY RUSTY. ENGAGEMENT UNDER MIN. - SEAR TO  
CONNECTOR.

COMPLAINT: FOLLOWS DOWN

INCIDENT: FOLLOW DOWN

COMMENTS: EVIDENTLY THE CUSTOMER EXPERIENCED A PIERCED  
PRIMER, WHICH WITH UNDER MIN ENGAGEMENT CAUSED  
THE CORNER OF THE SEAR TO CHIP OFF.