

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER NO. R 91-26323

INITIAL FPS	CUSTOMER ORDER NO.		COMMENTS			
DATE RECEIVED 12/11/91	DATE OPENED 12/17/91	DATE CODE EX 10-73	SERIAL NUMBER 6682161	NEW SERIAL NUMBER	MODEL AND GRADE 700 30-06	BDL
ACCESSORIES W/STUDS		L/SIGHTS				

FROM:	SHIP TO:
FRANKS GUN REPAIR 2376 IONA RD IDAHO FALLS USA	FRANKS GUN REPAIR 2376 IONA RD IDAHO FALLS USA
ID 83401	ID 83401

CUST NO: 001157 ILION L

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE <input type="checkbox"/>	CLEAN/TEST	PROM. DATE	ESTIMATED 1-6-92	VIA UPS
----------------	--------------------	--------------------------------	------------	------------	---------------------	------------

GUN CONDITION	REPAIR CHARGE
<input type="checkbox"/> NEW	EXCISE
<input type="checkbox"/> LIGHTLY WORN	TAX
<input type="checkbox"/> WORN	INSURANCE
<input type="checkbox"/> VERY WORN	UPS
<input type="checkbox"/> UNREPAIRABLE	PARCEL POST
	TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP	Guy has fired ON MOVING safety to fire possess					
BOLT ASSY.		B3			E2	F2
BARREL ASSY.		B4		D1	E3	F3
REC. ASSY.	Please repair to safe condition.					F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT *Cannot duplicate complaint. However, removal of failed action from stock revealed that the trigger assembly had been improperly adjusted outside of factory. Trigger pull below our min. spec of 24 pounds. 2) gear engagement insufficient 3) over-travel not sufficient. Trigger assembly also has excess lubrication. Trigger pull 23 pounds; rear lift .007"*

PARTS	COMMENTS
	<i>Offer new trigger assembly at 1/2 normal cost as gesture of good-will</i>

REPAIRMAN DE	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY .

RD6925 REV. 8/91