

bcc: Arms Service R-89-25230

**Remington** J. Hutton & B. Ericson  
Hold for Reply



## REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

November 7, 1989

Garretson's Sport Center Co.  
807-10th St.  
Greely, CO 80631

Gentlemen:

Examination has been completed on the Model 700 ADL 30-06 caliber rifle, serial number 6844935, that you returned to us a short time ago because, "... when safety is pushed to fire position, gun fires."

The returned firearm, which was produced in March of 1975, has been thoroughly examined and found to contain our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to being shipped from our factory.

The general condition of the rifle appeared to be well used and, in going over the individual parts, we found the headspace, recoil shoulders and chamber all to be normal.

Our initial testing and functioning of the rifle, in its as received condition, revealed that the trigger had no retraction spring action to properly position it on cocking. Sometimes the rifle would not cock when the bolt was closed, the firing pin would simply follow down on the bolt cocking cam.

Subsequent disassembly of the rifle disclosed that the trigger pull adjustment screw had been backed out to the point where no spring force was left. Trigger pull was measured to be 2-3/4 pounds, well below our minimum specification of 3-1/2 pounds. In future use, we strongly advise that the trigger not be adjusted by untrained non-Remington personnel.