



5/3/94
R 94 14700
Leonard Halson *Test*
Claims Fired on Bolt closing 60 minutes

- Bolt Stop Stock when depressed would not return
- Trigger pull measured $5\frac{1}{2}$ LBS as rec'd
- Seal lift measured .0085
- Sides of trigger were gummy & sticky
- Components appeared to be in good condition
- Was a 'light' off safe
- Powder Overtravel screw slot broken, trigger may have been adjusted and resealed.

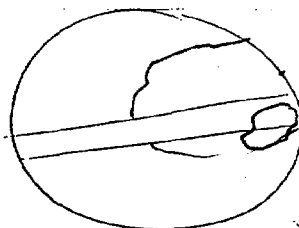

chip under sealant

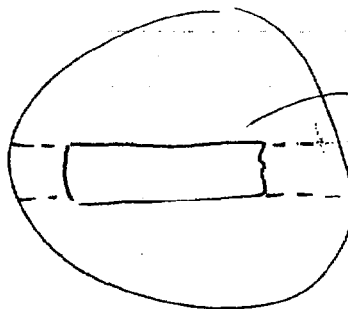

Sealant missing
on rear engagement
screw as shown