

Remington

REMINGTON ARMS COMPANY, INC.

SPORTING FIREARMS, AMMUNITION, TARGETS AND TRAPS

ILION, NEW YORK 13357

PAGE 1

02/13/91

DATE:

PARTS: (315) 895-7493, REPAIRS: (315) 895-7791

SOLD TO

REPAIR ORDER NO.: 9033774

SHIPPED TO

REPAIR ORDER NO.

1033774

HEDGECOTH, BILLY JOE
ROUTE 2 BOX 45
DEKALB

MS 39328

HEDGECOTH, BILLY JOE
ROUTE 2 BOX 45
DEKALB

39328

THIS IS A DESCRIPTION OF OUR CHARGES FOR THE REPAIR OR RECONDITIONING OF THE
ITEM(S) DESCRIBED BELOW. SHIPMENT WILL BE MADE IN APPROXIMATELY 4 WEEKS.

700 0000222

L/SIGHTS

BUL

SERIAL NUMBER: B6358731

CUSTOMER REQUEST:

GUN FIRES WITHOUT TOUCHING TRIGGER

MAIN FAULT FOUND:

TRIGGER ASSEMBLY IS CONTAMINATED WITH STICKY - GUMMY RESIDUE
INTERNAL TRIGGER PARTS ARE NOT MOVING FREELY - SEAR - SAFETY
CAM IS STICKING TO TRIGGER ASSEMBLY SIDE PLATES - STICKY RESIDUE
ON BOTTOM OF RECEIVER ALSO - THIS RIFLE HAS NOT BEEN PROPERLY
MAINTAINED - TRIGGER PULL 4 3/4 POUNDS SEAR LIFT .011

1 0026045 TRIGGER ASSEM RM
1 0040982 MAG FOLLOWER
1 0033450 BUL ASSEM 22/250
1 0023711 BUL BOLT ASSEM 308-243-0MM
1 0016715 MAGAZINE 244 REM
SPECIAL PRICE
GO AHEAD PER PHONE 2-11-91
KOSSEL

155.95

TOTAL REPAIR CHARGE
TAXES

155.95
9.36

INSURANCE
PARCEL POST

5.00

TOTAL
CHARGES

170.31

ALL PRICES QUOTED ARE IN DOLLARS FOR REPAIRED PARTS

FEB 21 1991

804923 REV 2, 90