

14 CUFFINGS

735 H-231NS

214 716 5 1/2

Model 700 BDL Custom Deluxe BOLT ACTION
22-BARREL / 30-06

76334914

221901

5792

Remington

The general condition of the gun appeared to be somewhat worn and it was noted that a scope had been mounted after it originally left our factory. In going over the individual parts, we found headspace normal, recoil shoulders normal, and chamber normal.

Examination of the rifle and trigger assembly could not duplicate the incident you have described. All parts tolerances and dimensions were found to be normal, including seat-connector engagement. However, it appears that the trigger adjustment screws have been altered outside of our company, as evidenced by the sealant having been removed from them, and over-torque was necessary; trigger pull was within our specifications at 17 pounds.

In our factory, Remington Arms Company, Inc., cannot accept any responsibility for the incident. When the safety is in the "off" position, the leaf is lifted out of the trigger connector. The only thing which is required to pull the trigger back is the connector to be moved away from under the leaf and the safety to the "on" position. The trigger is secured.