

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 92-05273

INITIAL CUSTOMER ORDER NO.

JJM 006749

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

02/10/92

02/14/92

AV 3-79

A6733138

700 30-06

ADL

ACCESSORIES

W/STUDS

SCOPE BASE

STEKL

FROM:

SHIP TO:

HOPKINS, HARRY E
RR 1 BOX 349
FALLS
UPS

PA 18615

HOPKINS, HARRY E
RR 1 BOX 349
FALLS
UPSPA
18615

CUST NO: 058196 CJO.D

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

FROM DATE

ESTIMATED

VIA

3/5/92

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP	<i>"The problem is that sometimes when the safety is released, it discharges"</i>				E2	F2
BOLT ASSY.						
BARREL ASSY.		B4		D1	E3	F3
REC. ASSY.		B5		D2	E4	F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT

Cannot duplicate above complaint. Trigger and safety assembly operates normally. However, it was noted that the assembly has been adjusted improperly outside the factory. Trigger pull is over (beyond maximum specification 2) Over travel is excessive. It was also noted trigger assembly was excessively oily. See lift. 011"

PARTS

COMMENTS

Offer to clean and re-adjust present trigger assembly (if possible). Or we can offer a new trigger assembly at a normal cost as a gesture of good-will.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 6

PPS 02401