

DON'T SAY IT-WRITE IT cc: D.J. Sanita

D.P. POLLEY

Location ARMS SERVICE 52-2

J.A. STEKL

Location PRODUCT SERVICE 52-4

Name

No.

Label R-02207 M/700 ADL 30-06 CALIBER RIFLE, S.N. A6485099

Date 5/5/80

Please replace the trigger assembly on this rifle and return to:

Dr. Sydney V. Jackson
411 Connie
Los Alamos, New Mexico 87544

Keep the old trigger assembly for possible future reference. Please complete the work and return the rifle, via U.P.S., as soon as possible.

Thank you.

JAS
JAS:cpp

10 179

STOP. LOCK. AND LIVE

.....
ger adjustment screws, indicating no alterations were made to the trigger outside of our Company.

As a part of our examination, a forty (40) round test was fired with the rifle using the following sequence: rifle loaded, safety put "on safe", rifle jarred, safety put "off safe", fire rifle, which produced no malfunctions; the rifle functioned normally in every respect.

Based on our findings, Remington Arms Company, Inc., cannot accept any liability or responsibility for the incidents. We can only assume that as the safety was pushed to the off position, contact was made with the trigger. When the safety is in the on safe position, the sear is lifted off of the trigger connector. At this time very little effort is required to pull the trigger rearward, allowing the connector to be moved away from under the sear, and in this condition, on moving the safety to the off position, the rifle will fire.

-1-

PPS 02565