

Gordon Kasper

R-9414311

Fires when safety is taken off

Unable to duplicate customer concern as rec'd.

• Trigger pull 2 to 2 1/4 lbs as rec'd


• Seal lift .0095

• Stock glass bedded

• Trigger Assy full of grease like substance, unable to see thru inspection hole in trigger Assy side plate

• Trigger has been adjusted outside of factory

• pounds pull and over travel backed out and re sealed
some sealant put on over original factory

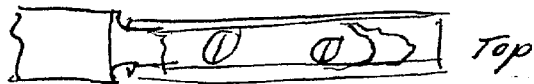

• Seal engagement reduced to ~~point~~ that .010
microscopic measurement