

M/700 Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700

GENERAL CONDITION: GOOD R #: 014720

OUTSIDE WORK: SCOPE MOUNTED, BUTT PLATE DATE: 7-24-72

CHANGED TO RECOIL PAD. FROM: S.R. MAYHOUL

FIRE AMMO TYPE: - MELBOURN, FLA.

& CONDITION: _____ GUN #: 357864

PROOF: R.E.P. INSP.: 0 TEST: 87 CODE: RP = 11/67

HEADING: O.K. GA./CAL.: 3006

BREECH OPENING: - CHECKED BY: C. PROSSER

RECOIL SHOULDERS: O.K. APPROVED: _____

CHAMBER: O.K. APPROVED: _____

TEST: NO APPROVED: _____

COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

TRIGGER ADJUSTING SCREWS NOT SEALED (NO INDICATION
THE EVER WERE). ENGAGEMENT SEAR TO TRIGGER CONNECTOR
.020, TRIGGER PULL 4LBS. TRIGGER RUBS ON GUARD.
GREASE LIKE LUBRICANT ON TRIGGER INSIDE HOUSING.

COMPLAINT: FIRES WHEN THE SAFETY IS THROWN OFF.

INCIDENT: FOLLOW DOWN

COMMENTS: THE HEAVY LUBRICANT COMBINED WITH FRICTION
OF THE TRIGGER AGAINST THE TRIGGER GUARD
CAUSED TRIGGER RETRACTION TO BE ERRATIC,
RESULTING IN FOLLOW DOWN.