

RECEIVING AND ESTIMATING REPORT				COMMENTS		ORDER			
INITIAL <b>TJN</b>		CUSTOMER ORDER NO.		<i>Product Service</i>		<b>R 93-28058</b>			
DATE RECEIVED <b>12/13/93</b>	DATE OPENED <b>12/17/93</b>	DATE CODE <b>CY 4-74</b>	SERIAL NUMBER <b>6736800</b>					NEW SERIAL NUMBER	MODEL AND GRADE <b>700 243 ADL</b>
ACCESSORIES <b>SCOPE BASE</b>									
FROM:				SHIP TO:					
<b>MCBRIDES GUN SHOP</b> <b>C/O NBS</b> <b>2915 SAN GABRIEL/30TH N LAMAR</b> <b>AUSTIN TX 78705</b>				<b>MCBRIDES GUN SHOP</b> <b>C/O NBS</b> <b>2915 SAN GABRIEL/30TH N LAMAR</b> <b>AUSTIN TX 78705</b>					
L REPRINT CUST NO:006578 WILM L									
ACCOUNT NUMBER <b>063103</b>		ACCOUNT NUMBER N/C		PROM. DATE	ESTIMATED	VIA <b>UPS</b>			
GUN CONDITION						REPAIR CHARGE <b>25.00</b>			
<input type="checkbox"/> NEW <input type="checkbox"/> LIGHTLY WORN <input checked="" type="checkbox"/> WORN <input type="checkbox"/> VERY WORN <input type="checkbox"/> UNREPAIRABLE <input type="checkbox"/> MARRED						EXCISE TAX INSURANCE UPS PARCEL POST TOTAL			
CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT			
CYCLE	A1	B1							
TRIGGER GROUP		B2							
BOLT ASSY.		B3			E2	E2			
BARREL ASSY.		B4		D1	E3	E3			
REC. ASSY.		B5		D2	E4	E4			
WOOD			C1	D3	E5	E5			
METAL			C2						
MAIN FAULT <i>Mfgn. date 4/74 - Magazine Spring, Safety lever, Breech Bolt lightly Rusted. Customer's concern resulted from insufficient sear engagement, caused by improper adjustment. Sealer on screws did not appear to be original factory sealer and fell off at the slightest touch. Sear engagement screw was tight in threads but turned in too much. Trigger Pull measured 1 to 1 1/2 LBS as need.</i>									
PARTS				COMMENTS					
				<i>Replace trig. Assy at 1/2 price            gesture of good will</i> <i>[Signature]</i> <i>1/21/94</i>					
				REPAIRMAN <i>JTB</i>	PROOF	CLEAN	TEST	TARGET	PATTERN
				GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV 1-92

PPS 03257