

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 600
GENERAL CONDITION: FAIR R # : 09920
OUTSIDE WORK: ? TRIGGER ASSEMBLY ADJUST- DATE: 4-27-71
MENTS INCORRECT FROM: N. SHORE SPTG. GDS.
FIRED AMMO TYPE: _____ RICE LAKE, WIS.
& CONDITION: _____ GUN # : 75441
PROOF: R.E.P. INSP.: U TEST: 66 CODE: ON = 7/66
HEADING: O.K. GA./CAL.: 308 WIN.
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

NO DAMAGED, BROKEN COMPONENTS.

SEAR CONNECTOR ENGAGEMENT .060+ (MAY HAVE BEEN CHANGED BY CUSTOMER) DIRT AROUND SEAR AND TRIGGER SPRING.

COMPLAINT: FIRES WHEN SAFETY IS PUSHED OFF-TRIGGER PULLED WITH SAFETY ON.

INCIDENT: FOLLOWS DOWN.

COMMENTS: COULD NOT DUPLICATE CUSTOMER'S MALFUNCTION. HOWEVER, TRIGGER-CONNECTOR DIMENSIONS PLUS DIRT INSIDE HOUSING COULD PERMIT A MALFUNCTION OF THIS TYPE. TRIGGER CLEARANCE ON CONNECTOR .003 OVER MAX. CONNECTOR CLEARANCE ON TRIGGER .002 UNDER MIN. CONNECTOR COULD WORK UP, INTERFERE WITH SEAR AND FAIL TO RETRACT.