

660
~~700~~ Customer Complaint

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 660
 GENERAL CONDITION: GOOD R #: 018859
 OUTSIDE WORK: NO DATE: 10-3-72
 FROM: GEO. ORNDUFF
 FIRED AMMO TYPE: - NEW MARTINSVILLE, W. VA.
 & CONDITION: _____ GUN #: 131278
 PROOF: R.E.P. ^{ASSEMBLY 18} INSP.: U TEST: 13 CODE: AR= 3/68
 HEADING: O.K. GA./CAL.: 243 WIN.
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: NO APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

HOUSING CUT IN RECEIVER OFF CENTER.ENGAGEMENT BETWEEN CONNECTOR & SEAR, 0.35 (MIN. IS 0.20). EXCESSIVE LUBRICANT INSIDE TRIGGER ASSEMBLY.COMPLAINT: DISCHARGED WHEN SAFETY WAS MOVED FROM ON TO OFF.INCIDENT: FOLLOW DOWN

COMMENTS: THE MALFUNCTION MAY HAVE BEEN CAUSED BY THE FIRING PIN HEAD CATCHING ON THE EXPOSED SIDE OF THE HOUSING INSTEAD OF SEATING ON THE SEAR THE RESULTING BURR IN THE HOUSING CAN CAUSE THE SEAR TO STICK.