

RECEIVING AND ESTIMATING REPORT

COMMENTS

ATTN J STEKL

INITIAL JM	CUSTOMER ORDER NO.		DATE RECEIVED 9/07/90		DATE OPENED 09/19/90	DATE CODE DR 9-68	SERIAL NUMBER 368540	MODEL AND GRADE 700 30-06 BDL	ORDER R 90-2415E
ACCESSORIES W/STUDS		SCOPE BASE							

FROM:

RAYCO SALES
9105 MENDENHALL MALL RD
JUNEAU AK 99801

SHIP TO:

RAYCO SALES
9105 MENDENHALL MALL RD
JUNEAU AK
99801

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA V409556133
----------------	--------------------	--------------------------------	------------	-----------	-------------------

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
-------------	-----	-----------	-----	-------------	-------

UN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☒ VERY WORN ☒ MISUSED ☐ MARRED

CUSTOMER'S REQUEST: "This rifle discharged while the owner was raising the bolt handle to extract a cartridge"

MAIN FAULT: Rifle has not been properly maintained - trigger assembly is contaminated with oil and gumming residue (as is bolt & firing pin assembly). Movement of internal trigger parts is sluggish, even at room temperature. Cold temperatures combined with contamination could possibly cause mal-function. Trigger pull 4#, rear-lift 1008". Could not duplicate complaint.

Clean trigger assembly, if possible. If not, send quotation for replacement trigger assembly at $\pm$ normal price, as gesture of good-will.

9/21/90
JLS

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

RD6925 REV. 6/88

OFFICE COPY

PPS 04058