

RECEIVING AND ESTIMATING REPORT

INITIAL FPS		CUSTOMER ORDER NO.		COMMENTS W/BTM OF SEE THRU SCOPE MOUNT	
DATE RECEIVED 01/10/91	DATE OPENED 01/16/91	DATE CODE	SERIAL NUMBER B6210700	MODEL AND GRADE 700 30-06 BDL	ORDER R 91-0162
ACCESSORIES W/STUDS					

KA 5-80 2ND TIME IN

FROM:	SHIP TO:
REIMER, ROBERT 249 MAIN ST SLATINGTON PA 18080	REIMER, ROBERT 249 MAIN ST SLATINGTON PA 18080

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐ CLEAN/TEST	PROM. DATE	ESTIMATED 1-24-91	VIA UPS
----------------	--------------------	---	------------	-----------------------------	-------------------

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

GUN CONDITION: ☐ NEW ☐ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED

CUSTOMER'S REQUEST
Firing pin didn't hit primer, shell went off when opening Bolt. Gun jammed. Gun (unsafe) to use.

MAIN FAULT
Cannot duplicate above complaints. Trigger and safety assembly operate normally. Trigger pull 7.5 lbs. semi-left "click". Trigger assembly and firing pin assembly are dipping out with excessive lubricants. The excessive lubrication in the firing pin assembly, coupled with cold weather, could explain the problems encountered - improper maintenance.

PARTS
*1) Clean inside of bolt and trigger assembly if possible.
2) Option for replacement trigger assembly at normal cost, suggestion of good will if it will restore your confidence in the rifle.
Scope Mounts in Box*

REPAIRMAN RBS	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

6925 REV. 7/90

PPS 04126