

4/20/94

R94-13082

SEAR LIFT .014

TR16 PULL 5-5.5 LBS

Engagement seems - OK

No lubricant - dry.

ATTRIBUTE GAGE - WOULD NOT FIT

Trigger has some creep

Some rust on underside of hand at ^{FORE-END} pressure pa

Seal engagement measured .021

Unable to duplicate customer concern

trigger operates normally in every respect

Components dry and clean appear that some original moly coat is still on side plates also on bolt plug studs.

Removed trigger and connector both clean and dry

Mouth of housing also clean and dry