

Remington.



Remington
R-89-09364
make repairs at no charge, fit n
trigger assembly & clean acti-
B. Ericson & J. Hutton

REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

April 5, 1989

Mr. Duain B. Shaw
1204 Apple Dr.
Mechanicsburg, PA 17055

Dear Mr. Shaw:

Our experts have completed their examination of the Model 700 BDL, 270 caliber rifle, serial number B6215100, that you returned with trigger problems.

The returned firearm, which was produced in 1980, has been thoroughly examined and found to bear our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspections prior to being shipped from our factory.

The general condition of the rifle appeared to be very good, and it was noted that the stock assembly was bedded to the action outside our factory. In going over the individual parts, we found the headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly in its as received condition could not produce any malfunctions.

Removal of the barrel-action from the stock assembly revealed that the factory sealant had been removed and not replaced on the over-travel adjustment screw, indicating that adjustments to the trigger assembly have been tampered with outside the factory. The receiver, trigger assembly, and bolt stop release were wet with excessive lubrication. The bolt stop was working very sluggish from solidified oil (?).

Mr. Shaw, in future use, we recommend that the trigger assembly not be adjusted by untrained non-Remington personnel, and that oil be