

RECEIVING AND ESTIMATING REPORT

COMMENTS

W/ BOTTOM HALF OF SEE THRU MNTS

ORDER
R 92-18838

INITIAL
FJB

CUSTOMER ORDER NO.

DATE RECEIVED
09/09/92

DATE OPENED
09/18/92

DATE CODE
LI 2-76

SERIAL NUMBER
A6268583

NEW SERIAL NUMBER

MODEL AND GRADE
700 30-06

ADL

ACCESSORIES

W/STUDS

FROM:

SHYDAS GUN SHOP
1635 S LINCOLN AVE
LEBANON

PA 17042

SHIP TO:

SHYDAS GUN SHOP
1635 S LINCOLN AVE
LEBANON

PA
17042

CUST NO: 005936 WILM

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
- ☐ LIGHTLY WORN
- ☐ WORN
- ☐ VERY WORN
- ☐ UNREPAIRABLE
- ☐ MARRED

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

B1

TRIGGER GROUP

B2

BOLT ASSY.

B3

BARREL ASSY.

B4

EC ASSY.

B5

WOOD

C1

METAL

C2

MAIN FAULT

As required, rifle would not cock when bolt was closed, firing pin simply followed down on cocking cam. Disassembly of rifle revealed trigger mechanism had been improperly adjusted out of factory (excessive main spring adjustment screws). 1) Trigger pull felt too heavy - 24 pounds. 2) Sear engagement inadequate. No retraction spring force on trigger due to improper adjustment. Trigger pull 24 pounds; sear lift .011"

COMMENTS

Since sear engagement has been tampered with, offer new trigger assembly at 1/2 normal cost, as gesture of good-will

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE