

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 91-25205

INITIAL LCS	CUSTOMER ORDER NO.		DATE RECEIVED 12/04/91			DATE OPENED 12/06/91	DATE CODE WD 8-83	SERIAL NUMBER B6487829	NEW SERIAL NUMBER	MODEL AND GRADE 700 30-06	BDL
ACCESSORIES W/STUDS		SCOPE BASE									

FROM:

THOMAS, JEFF
1911 GLENWAY AVE
COVINGTON
USA

KY 41014

SHIP TO:

THOMAS, JEFF
1911 GLENWAY AVE
COVINGTON
USA

KY
41014

CUST NO: 054217 C.O.D

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE <input type="checkbox"/>	CLEAN/TEST	PROM. DATE	ESTIMATED	VIA UPS
----------------	--------------------	--------------------------------	------------	------------	-----------	------------

- GUN CONDITION
- NEW
 - LIGHTLY WORN
 - WORN
 - VERY WORN
 - UNREPAIRABLE

REPAIR CHARGE
EXCISE
TAX
INSURANCE
UPS
PARCEL POST
TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP		B2			E1	F1
BOLT ASSY.		B3			E2	F2
BARREL ASSY.		B4		D1	E3	F3
REC. ASSY.		B5		D2	E4	F4
WOOD			C1	D3	E5	F5
METAL			C2			

Delay in firing after trigger was pulled.

MAIN FAULT

*Could not duplicate complaint. However disassembly of all
recoiled parts of trigger assembly is contaminated with sticky
substance, inhibiting proper movement of rear safety cam post.
Trigger assembly will operate in cold temperatures, this could
conceivably cause a delay in firing from drop.*

Trigger pull 4 3/4 pounds; rear lift .014"

PARTS

COMMENTS

*Clean present trigger assembly,
if possible. If not, offer replacement
assembly at 50% refund cost, as a
gesture of good-will.*

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE