

RECEIVING AND ESTIMATING REPORT

INITIAL		CUSTOMER ORDER NO.		COMMENTS	
CS					
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE	ORDER
9/07/90	09/19/90	00 7-77	A6485963	700 30-06	R 90-24163
ACCESSORIES					
L/MAG BOX		L/WOOD		L/FOLLOWER	L/MAG SPRING L/SIGHTS
L/ FLOOR PLATE					

FROM:	SHIP TO:
VILLMANN, ALAN E LEXINGTON HILL CONDO I-2 HARRIMAN NY 10926	VILLMANN, ALAN E LEXINGTON HILL CONDO I-2 HARRIMAN NY 10926

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	PROM. DATE	ESTIMATED	VIA
					V437818695

REPAIR CHARGE						TAX	INSURANCE	UPS	PARCEL POST	TOTAL

GUN CONDITION:					
☐ NEW	☐ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED	
CUSTOMER'S REQUEST <i>refle firing when safety was released</i>					

MAIN FAULT	1) Trigger pull adjusted too light (2 1/2# below spec) out of factory. 2) Trigger assembly contaminated with excessive lubrication; internal part not moving freely, trigger reaction is not consistent. Rifle operates acceptably at room temperature, however, cold temperatures could cause problems.
------------	--

ARTS	Per phone call to customer on 10/16/90 — 1) replace trigger assembly with new one at 1/2 normal price (food on agency rifle) 2) adjust trigger pull to 3 1/2 - 4# 3) return rifle C.O.D. 4) please expedite & ship asap.
------	--

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV. 6/86

PPS 05237