

RECEIVING AND ESTIMATING REPORT			COMMENTS		ORDER R91-24360
INITIAL	CUSTOMER ORDER NO.		ATTN JIM STEKL		
LCS					
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
11/22/91	11/26/91	AO 3-77	A6430942		700 308 BDL
ACCESSORIES W/STUDY SCOPE BASE					

FROM:	SHIP TO:
VINKEMULDER, SCOTT 9900 IVANREST BYRON CENTER USA	VINKEMULDER, SCOTT 9900 IVANREST BYRON CENTER USA
MI 49315	MI 49315

CUST NO: 053695 C.O.D L

ACCOUNT NUMBER	ACCOUNT NUMBER W/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED	VIA UPS
GUN CONDITION ☐ NEW ☐ LIGHTLY WORN ☐ WORN ☐ VERY WORN ☐ UNREPAIRABLE				REPAIR CHARGE EXCISE TAX INSURANCE UPS PARCEL POST TOTAL		

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	B1				
TRIGGER GROUP		B2			E1	F1
BOLT ASSY.		B3			E2	F2
BARREL ASSY.		B4		D1	E3	F3
REC. ASSY.		B5		D2	E4	F4
WOOD			C1	D3	E5	F5
METAL			C2			

MAIN FAULT Rifle could be made to malfunction as described by customer. Subsequent disassembly of rifle revealed rusting on bottom of barrel, receiver, outside and inside of trigger assembly. Examination of the trigger assembly revealed that because of rusting on the internal parts were not moving freely nor properly. Trigger was not moving freely. Replaced trigger assembly with new parts and on pistol. Removal of firing pin from bolt revealed rust on interior of bolt body and firing pin assembly. Apparently rifle became wet at some time and was not properly cleaned and maintained afterwards.

COMMENTS

- 1) Send quotation for thorough cleaning and oiling
- 2) Quote for new trigger assembly at 1/2 normal cost, as a gesture of good-will

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE