

RECEIVING AND ESTIMATING REPORT

CUSTOMER ORDER NO.		COMMENTS		STEKL		ORDER	
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE			
05/19/88	05/31/88	PH 6-87	B6867418	700 270	ADL	R	88-15784
ACCESSORIES		L/SIGHTS					

FROM:	SHIP TO:
LATHMAN SERVICE CTR. RT 3 DRESDEN, TN.	LATHMAN SERVICE CTR. RT 3 DRESDEN, TN.
38225	38225

ACCOUNT NUMBER	PROM. DATE	ESTIMATED	VIA	UPS
REPAIR CHARGE	TAX ST	INSURANCE	UPS	PARCEL POST
TAX CITY				TOTAL
				\$

GUN CONDITION: ☐ NEW ☒ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ QUOTE

CUSTOMER'S COMPLAINT
"bolt follows down on closing" "one day it went off when I pulled it"

MAIN FAULT
Trigger has been adjusted outside factory: 1) trigger pull 1 1/2 lbs. no spring retention; 2) Sear engagement has been set below Remington specification.

PARTS
Re-adjust trigger assembly to Remington specifications - return to customer. Charge as required
6/16/88
JMB

FOR COMPUTER REF. ONLY	PROOF
	(CLEAN) (TEST) (TARGET)
	REPAIRMAN