

RECEIVING AND ESTIMATING REPORT

AL		CUSTOMER ORDER NO.		COMMENTS W/ BOTTOM HALF OF SCOPE MNTS			
RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE		ORDER	
12/91	02/19/91	CD 4-77	A6444481	700	270	BDL	R 91-04878
ACCESSORIES		W/STUDS		L/SIGHTS			

FROM:	SHIP TO:
YOUNG, CHARLES H 13401 REDCOAT LANE PHOENIX MD 21131	YOUNG, CHARLES H 13401 REDCOAT LANE PHOENIX MD 21131

COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED	VIA UPS
--------------	--------------------	--------------------------------	------------	------------	-----------	---------

AIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
------------	-----	-----------	-----	-------------	-------

IN CONDITION:	☐ NEW	☐ SLIGHTLY WORN	☐ VERY WORN	☐ MISUSED	☐ MARRED
---------------	------------------------------	--	------------------------------------	----------------------------------	---------------------------------

"However, as I closed the bolt, the chambered round fired"

TS
N FAULT
Cannot duplicate complaint. However, the trigger assembly has been improperly adjusted outside the factory - factory without missing from all adjustment screws - 1) insufficient over-travel 2) insufficient rear engagement 3) Trigger pull below spec at 2 1/2 - 2 3/4 pounds. Also, as viewed, the magazine top was installed upside-down.

Send repair quotation for new-style trigger assembly (2nd - best bid) at 1/2 normal cost, as a gesture of good-will.

note: scope bases at inspection					
REPAIRMAN LEW	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY *STe & L*

RD6925 REV. 7/90

PPS 05634