

P.I. NO GUN EXAMINATION REPORT NUMBER: _____ MODEL: 700
GENERAL CONDITION: NEW R #: _____
OUTSIDE WORK: NO DATE: 3-3-75

FROM: _____
FIRED AMMO TYPE: -
& CONDITION: _____ GUN #: 6356761
PROOF: R.E.P.-E INSP.: 74 TEST: 13 CODE: OT = 7/70
HEADING: ? GA./CAL.: 25-06 REM.
BREECH OPENING: _____ CHECKED BY: C. PROSSER
RECOIL SHOULDERS: O.K. APPROVED: _____
CHAMBER: O.K. APPROVED: _____
TEST: NO APPROVED: _____
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

FIRING PIN HEAD GUIDE SLOT NOT CENTERED
WITH HOUSING SLOT. FIRING PIN HEAD POORLY
CHAMFERED.

COMPLAINT: SAFETY MALFUNCTION

INCIDENT: FIRING PIN HEAD CATCHES ON LEFT SIDE OF
HOUSING (PROTRUDING INTO SLOT) SO THAT ACTION
WILL NOT FIRE AS TRIGGER IS PULLED UNTIL BOLT
HANDLE IS LIFTED.

COMMENTS:

RECEIVER MEASURED EDGE OF FIRING PIN HEAD
GUIDE SLOT TO SIDE OF HOUSING SLOT
RIGHT SIDE = .073, LEFT SIDE = .056