

P.I. NO GUN EXAMINATION REPORT NUMBER: \_\_\_\_\_ MODEL: MOHAWK 600  
GENERAL CONDITION: NEW R #: \_\_\_\_\_  
OUTSIDE WORK: SCOPE MOUNTED DATE: 3-3-75  
FROM: \_\_\_\_\_  
FIRED AMMO TYPE: \_\_\_\_\_  
& CONDITION: \_\_\_\_\_ GUN #: 6651698  
PROOF: R.E.P.-B INSP.: U TEST: 13 CODE: OX = 7/73  
HEADING: \_\_\_\_\_ GA./CAL.: 6MM REM.  
BREECH OPENING: \_\_\_\_\_ CHECKED BY: C. PROSSER  
RECOIL SHOULDERS: O.K. APPROVED: \_\_\_\_\_  
CHAMBER: O.K. APPROVED: \_\_\_\_\_  
TEST: NO APPROVED: \_\_\_\_\_  
COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: \_\_\_\_\_

FIRING PIN HEAD GUIDE SLOT NOT CENTERED WITH  
HOUSING SLOT. REAR LEFT CORNER OF HOUSING UPSET  
BY ASSEMBLER ATTEMPT TO RELIEVE THE INTERFERENCE  
BETWEEN FIRING PIN HEAD AND HOUSING. SEAR BINDING  
ON BURR.

COMPLAINT: SAFETY MALFUNCTION

INCIDENT: FIRING PIN HEAD CATCHES ON LEFT SIDE OF HOUSING  
(PROTRUDING INTO SLOT) SO THAT ACTION WILL NOT FIRE AS  
TRIGGER IS PULLED, UNTIL BOLT HANDLE IS LIFTED.

COMMENTS: RECEIVER MEASURED, EDGE OF FIRING PIN  
GUIDE SLOT TO SIDE OF HOUSING SLOT.

RIGHT SIDE = .072 LEFT SIDE = .054