

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R 92-00204INITIAL
JJM

CUSTOMER ORDER NO.

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

NEW SERIAL NUMBER

MODEL AND GRADE

12/23/91

01/03/92

XE 12-84

7641400

7 308

ACCESSORIES

W/STUDS

SCOPE BASE

1/REAR SIGHT

FROM:

SHIP TO:

ACES GUNS
INTERSECTION 271 & 334
RT 2 BOX 98
HAWESVILLE
USA

KY 42348

ACES GUNS
INTERSECTION 271 & 334
RT 2 BOX 98
HAWESVILLE
USAKY
42348

CUST NO: 001867 C.O.D.L.

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORN
☐ WORN
☐ VERY WORN
☐ UNREPAIRABLE

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

B1

TRIGGER GROUP

BOLT ASSY.

BARRREL ASSY.

REC. ASSY.

WOOD

METAL

"see the gun has, changed shifts when they were placed in the gun, without even touching the triggers"

MAIN FAULT

Cannot duplicate complaint. However, it was noted trigger assembly is wet with excess oil and the trigger pull weight has been adjusted outside of factory to below our minimum specification.

Trigger pull $2\frac{3}{4}$ pounds; rear-lift .016"

PARTS

COMMENTS

Offer to clean and re-adjust present trigger assembly, or, we can install a new trigger assembly at $\frac{1}{2}$ normal cost, as a gesture of good-will if it will better restore confidence in the rifle.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

COPY

RD6925 REV. 8/9

PS00276