

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER
R92-17499

L/FLOOR PLATE, SCREWS

STEEL

INITIAL FPS	CUSTOMER ORDER NO.	DATE RECEIVED 08/20/92	DATE OPENED 09/01/92	DATE CODE QQ 7-78	SERIAL NUMBER A6648299	NEW SERIAL NUMBER	MODEL AND GRADE 700 270 WIN LH
ACCESSORIES	L/MAG BOX	L/WOOD	L/FOLLOWER	L/MAG SPRING	SCOPE BASE	L/SIGHTS	

FROM:

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ 07109

SHIP TO:

BULLET HOLE
78 RUTGERS ST
BELLEVILLE

NJ

07109

CUST. NO: 009025 C.O.D. L

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED	VIA UPS
GUN CONDITION						REPAIR CHARGE
☐ NEW						EXCISE
☐ LIGHTLY WORN						TAX
☐ WORN						INSURANCE
☐ VERY WORN						UPS
☐ UNREPAIRABLE						PARCEL POST
☐ MARRED						TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
CYCLE	A1	1) Sometimes bolt would not cycle when opened				
TRIGGER GROUP		2) Sometimes bolt would fall when safety released				F2
BOLT ASSY.		3) Now getting lighter hit on plunger.				F3
BARREL ASSY.				D1	E3	F4
REC. ASSY.			B5	D2	E4	F5
WOOD			C1	D3	E5	
METAL			C2			

MAIN FAULT Cannot duplicate complaints 1 & 2 above - with specs to operate proper however, trigger has been improperly adjusted, set at factory 1) trigger pull above maximum (cm spec of 5.4 pounds (7 pounds at 6.2) 2) insufficient over-travel. Also trigger assembly contains an excessive amount of oil, dust, dirt, etc.

ARTS	COMMENTS				
	1) Offer to clean & readjust present trigger assembly to our specs.				
	2) We can install a new trigger group at a normal cost of that will better instill confidence in the rifle.				
	Check out firing pin indent on pr. #3 complaint.				
REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
hse					
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

PS00979