

RECEIVING AND ESTIMATING REPORT

COMMENTS
ATTN J STEKL

INITIAL JJM	CUSTOMER ORDER NO.					
DATE RECEIVED 01/31/90	DATE OPENED 02/06/90	DATE CODE DE 9-84	SERIAL NUMBER 7636542	MODEL AND GRADE 7 7MM08		ORDER R 90-04878
ACCESSORIES W/STUDS		L/SIGHTS				

FROM:	SHIP TO:
ROBBY CHANDLER ROUTE 1 CRACKERS NECK BIG STONE GAP VA 24219	ROBBY CHANDLER ROUTE 1 CRACKERS NECK BIG STONE GAP VA 24219

ACCOUNT NUMBER	ACCOUNT NUMBER N/C	WRITE <input type="checkbox"/>	PROM. DATE	ESTIMATED	VIA UPS
----------------	--------------------	--------------------------------	------------	-----------	------------

REPAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
---------------	-----	-----------	-----	-------------	-------

GUN CONDITION: ☐ NEW ☒ SLIGHTLY WORN ☐ VERY WORN ☐ MISUSED ☐ MARRED

CUSTOMER'S REQUEST

Fire on bolt closing

MAIN FAULT

*Trigger assembly severely contaminated with gummy, oily residue -
 rear-safety cam sticking to side plate of trigger assembly. At time
 bolt will not cock, firing pin follows down when bolt closed.*

PARTS

Called customer 2/15/90 and explained findings. He elected to have us install new trigger assembly at N/C as good-will gesture.

Install new trigger assembly at N/C

2) charge \$10.00 handling plus return shipping - return <0.0. 2/15/90 JMS

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

RD6925 REV. 6/88

PS01400