

RECEIVING AND ESTIMATING REPORT

COMMENTS

BBL NOT OF OUR MFG
L/FLOOR PLATE, SCREWS

INITIAL CUSTOMER ORDER NO.

FPS

DATE RECEIVED

DATE OPENED

DATE CODE

SERIAL NUMBER

MODEL AND GRADE

ORDER

06/20/91

06/24/91

6234123

700

223

ARMY

R

91-13039

ACCESSORIES

L/WOOD

SCOPE BASE

FROM:

SHIP TO:

CLINTON RIVER GUN SERVICE
30016 S RIVER RD
MT. CLEMENS MI 48045

CLINTON RIVER GUN SERVICE
30016 S RIVER RD
MT. CLEMENS MI 48045

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

CLEAN/TEST

PROM. DATE

ESTIMATED

VIA

UPS

REPAIR CHARGE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

GUN CONDITION:

☐ NEW

☐ SLIGHTLY WORN

☐ VERY WORN

☐ MISUSED

☐ MARRED

CUSTOMER'S REQUEST

Repair

"Firearm discharges when taking safety off"

MAIN FAULT

Trigger assembly tampered with and improperly adjusted outside factory, as evidenced by foreign yellow sealant - 1) insufficient rear-engagement (as measured, firing pin should sometimes not cock) 2) trigger pull as received $\approx$ 1 pound - trigger activation not positive because of excessively light pull weights

PARTS

Offer replacement trigger assembly at the normal cost, as gesture of good-will.

REPAIRMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE