

COMMENTS

R 91-26323 ^{ORDER}

FPS

DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	NEW SERIAL NUMBER	MODEL AND GRADE
12/11/91	12/17/91	EX 10-73	6682161		700 30-06 BDL
ACCESSORIES	W/STUDS	L/SIGHTS			

FROM:

FRANKS GUN REPAIR
2376 IONA RD
IDAHO FALLS
USA

ID 83401

SHIP TO:

FRANKS GUN REPAIR
2376 IONA RD
IDAHO FALLS
USA

83401 ID

CUST NO:001157 BLION

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE

CLEAN/TEST

FROM DATE

ESTIMATED	
-----------	--

VIA

LIF'S

GUN CONDITION

NEW

☐ LIGHTLY WORN

☐ WORN

☐ VERY WORN

☐ UNREPAIRABLE

REPAIR CHARGE

EXCISE

TAX

INSURANCE

UPS

PARCEL POST

TOTAL

CUSTOMER CONCERN	AMMO	FUNCTION	FINISH	ACCURACY	FIT	INSPECT
------------------	------	----------	--------	----------	-----	---------

CYCLE	A1	B1	
TRIGGER GROUP	Gun has fired on moving safety to fire possess		
BOLT ASSY.			F2
BARREL ASSY.		B4	F3
REC. ASSY.	Please repair to safe condition.		F4
WOOD		C1	F5
METAL		C2	

MAIN FAULT Cannot duplicate complaint. However, removal of bind-
from stock reveals that the trigger assembly has been improperly
adjusted outside of factory. 1) Trigger pull below our min. spec. of 28
pounds 2) rear engagement insufficient 3) over-travel not sufficient
Trigger assembly also has excess lubrication.
Trigger pull 22 pounds; rear lift .007"

[illegible]

OFFICE COPY

RD6925 REV 8/91

PS02328