



TRACKING DOCUMENT



Repair Order Number

Repair Order Number RE00088254	Description/Serial Number A6476599	Repairman - Bruce Travis Date Received - 12/3/2004
Account # - R-	Model 700 Center Fire Caliber: 3006 SPRG WOOD ADL	Estimate Date - 11/30/2004 Current Date - 12/8/2004
Customer FAIRCLOTH & SONS INC 1425 US 82 WEST LEESBURG GA 31763 US		Return To FAIRCLOTH & SONS INC 1425 US 82 WEST LEESBURG GA 31763 US
Phone (H) (229)-435-2616 Phone (W)		Fax Email

Problems			
Reported		Found	
M123	FORWARD TO PRODUCT SERVICE FOR INSPECTION	M123	FORWARD TO PRODUCT SERVICE F
M992	FIRES WHEN CLOSING BOLT		

Repair					
<u>Material #</u>	<u>MaterialDesc</u>	<u>Quantity Needed</u>	<u>Quantity From Inv</u>	<u>Quantity From Kit</u>	<u>Warranty (Y/N)</u>
Part					
F26345	700 TRIG ASSB RH	1	1	0	Y
Part Total:		1	1	0	
Service					
4000119	GR-TEST	1	1	0	Y
4000104	ARMS SERV SHIPPING & HANDLING	0	0	0	N
4000116	GR-LABOR	20	20	0	N
Service Total:		21	21	0	

Condition					
ProblemNotes	trigger assm is contaminated with a partially dried and sticky lubrication residue causing searcam to stick to side plates. replace trigger assm & clean action under bolt lock program for \$20.00				
Repairman	Proof	Clean	Test	Target	Pattern
Gallery Tester	Date	Date	Date	Date	Date