

Remington

REMINGTON ARMS COMPANY, INC.
SPORTING FIREARMS, AMMUNITION, TARGETS AND TRAPS
ILION, NEW YORK 13357

PAGE 1

02/13/91

DATE:

PARTS: (315) 895-7493, REPAIRS: (315) 895-7791

SOLD TO

REPAIR ORDER NO.: 9033774

SHIPPED TO

REPAIR ORDER NO.
1021119

HEGGETH, BILLY JOE
ROUTE 2 BOX 55
DEKALB

MS 39328

HEGGETH, BILLY JOE
ROUTE 2 BOX 55
DEKALB

19420

THIS IS A DESCRIPTION OF OUR CHARGES FOR THE REPAIR OR RECONDITIONING OF THE ITEM(S) DESCRIBED BELOW. SHIPMENT WILL BE MADE IN APPROXIMATELY 4 WEEKS.

700 0000222 BUL SERIAL NUMBER: B6358731
M/STUDS L/SIGHTS

CUSTOMER REQUEST:
GUN FIRES WITHOUT TOUCHING TRIGGER

MAIN FAULT FOUND:
TRIGGER ASSEMBLY IS CONTAMINATED WITH STICKY - GUNNY RESIDUE
INTERNAL TRIGGER PARTS ARE NOT MOVING FREELY - SEAR - SAFETY
CAM IS STICKING TO TRIGGER ASSEMBLY SIDE PLATES - STICKY RESIDUE
ON BOTTOM OF RECEIVER ALSO - THIS RIFLE HAS NOT BEEN PROPERLY
MAINTAINED - TRIGGER PULL 4 3/4 POUNDS SEAR LIFT .011

- 1 0020000 TRIGGER ASSEMBLY
- 1 0040000 MAG FOLLOWER
- 1 0030000 BUL ASSEMBLY 22/250
- 1 0020000 BUL BOLT ASSEMBLY 308-243-0MM
- 1 0010000 MAGAZINE 244 REM
- 1 0010000 SPECIAL PRICE
- 00 AMEAU PER PHONE 2-11-91
- KDS:EL

155.95

TOTAL REPAIR CHARGE	155.95
TAXES	9.36
INSURANCE	
PARCEL POST	5.00
TOTAL CHARGES	170.31

ALL PRICES QUOTED ARE IN CASH/PAID FOR REPAIRED PARTS

FEB 21 1991

000022 REV 1.10