

RECEIVING AND ESTIMATING REPORT

COMMENTS

ORDER

R 94-17200

INITIAL
F.P.S.

CUSTOMER ORDER NO.

DATE RECEIVED
05/31/94DATE OPENED
06/01/94DATE CODE
LY 2-74SERIAL NUMBER
6719070

NEW SERIAL NUMBER

MODEL AND GRADE
700 30-06

BDL

ACCESSORIES W/STUDS SCOPE BASE

FROM:

HERRGARD, GORDON L.
RR 1 BOX 89
DEER RIVER

MN 56636

SHIP TO:

HERRGARD, GORDON L.
RR 1 BOX 89
DEER RIVERMN
56636

CUST NO: 098014 C.O.D.L.

ACCOUNT NUMBER

ACCOUNT NUMBER N/C

WRITE ☐

PROM. DATE

ESTIMATED

VIA

R776982517

GUN CONDITION

- ☐ NEW
☐ LIGHTLY WORKED
☒ WORN
☐ VERY WORN
☐ UNREPAIRABLE
☒ MARRED

REPAIR CHARGE 20

EXCISE

TAX

INSURANCE

UPS 8

PARCEL POST

TOTAL 28.00

CUSTOMER CONCERN

AMMO

FUNCTION

FINISH

ACCURACY

FIT

INSPECT

CYCLE

A1

TRIGGER GROUP

BOLT ASSY.

BARREL ASSY.

REC. ASSY.

WOOD

METAL

The rifle has fired twice by itself when the safety was taken off. Took the rifle to someone who works on guns and he did some adjusting on the trigger pull. Let me know in writing what you do to this rifle.

MAIN FAULT

Mfg. 2-74 Unable to duplicate customer concern as recd. - trigger has notable creep. All three trigger adjusting screws have been altered outside of factory. Excessive lubrication inside of trigger assy. Unable to confirm or determine original concern due to alterations. We do not recommend that the trigger be adjusted outside of the factory. Metal parts only require a light film of light oil to prevent rusting. Exchange trigger assy at special price as a gesture of good will and to restore customer confidence in rifle.

PARTS

COMMENTS

Trigger pull measured 5 to 5 1/4 lbs. As recd. sear lift was .008

Trigger pin & spring rusty

BENCHMAN

PROOF

CLEAN

TEST

TARGET

PATTERN

GALLERY TESTER

DATE

DATE

DATE

DATE

DATE

OFFICE COPY

RD6925 REV. 1/94

PS03169