


Leonard Halson *Test*
Claims

5/3/94


R 9414700-

Fired on Bolt closing 60 minutes

- Bolt Stop Stock when depressed would not return
- Trigger pull measured $5\frac{1}{2}$ LBS as rec'd
- Ser lft measured .0085
- Sides of trigger were gummy & sticky
- Components appeared to be in good condition
- Has a 'light' off safe
- Forward Overtravel screw slot broken, trigger may have been adjusted and resealed.

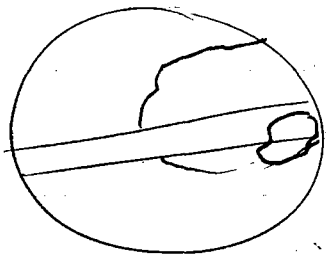

chip under sealant

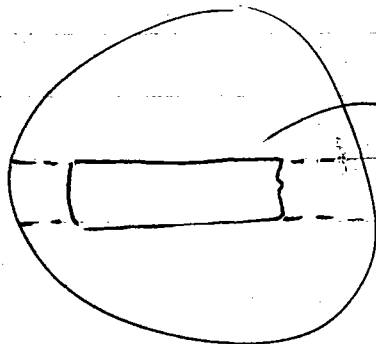

Sealant missing
on rear engagement
screw as shown