

Gordon Kasper

R-9414311

Fires when safety is taken off

Unable to duplicate customers concern as rec'd.

• Trigger pull 2 to 2 1/4 lbs as Rec'd

• Ser. left .0055

• Stack glass bedded

• Trigger Assy full of grease like substance, unable to see thru inspection hole in trigger assy side plate

• Trigger has been adjusted outside of factory

• pounds pull and over travel backed out and resealed
some sealant put on over original factory



• Seal engagement reduced to point that .010
microscopic measurement