

Date: 10/18/04
By: Brian Thomas

FIREARM INSPECTION WORKSHEET

BACKGROUND

Customer name: New River Trading LLC
R.E. Number: 86424
Reason for inspection: mishap - sometimes goes off

FIREARM

Manufacturer: Rem. Model: 700
Serial Number: B6466788 Date of Manufacture: 6/83
Overall external condition: Good

Barrel condition: okay
Receiver condition: okay
Stock condition: okay
Bolt/firing pin condition: okay
Trigger assembly condition:

Engagement: altered
Adjustments/alterations: altered
Other: contaminated w/ sticky lubrication residue

Headspace: —

Function evaluation:

Feeding: _____

Extraction/ejection: _____

Trigger pull: sear arm frozen to side plates

Manual safety: okay

Test firing results (if applicable): _____

DISPOSITION

all three dry asm set screws altered; dry asm. is
contaminated w/ a partially dried & sticky lubrication residue,
causing sear arm to stick to side plates. replace complete.
ADDITIONAL COMMENTS TPA - clean action at 1/2 msp. Quote